

INSTRUCTION MANUAL

3273

CLAMP ON PROBE

HIOKI E.E. CORPORATION

Contents

Introduction	i
Inspection	i
Safety Notes	
Note on Use	
Note on ose	IV
Chapter 1 Overview	1
1.1 Product Overview	
1.2 Features	1
1.3 Names of Parts	2
1.4 Parts of the Sensor	3
Chapter 2 Specifications	5
2.1 Product Specifications	5
2.2 Standards Applying	····· 7
,	
Chapter 3 Measurement Proced	ıre9
3.1 Notes on Use	
3.2 Preparations for Measurement	
3.3 Demagnetizing and Zero Adjus	
3.4 Measurement Procedure	16

Introduction

Thank you for purchasing the HIOKI "3273 CLAMP ON PROBE". To obtain maximum performance from the device, please read this manual first, and keep it handy for future reference.

Inspection

When you receive the device, inspect it carefully to ensure that no damage occurred during shipping. If damage is evident, or if it fails to operate according to the specifications, contact your dealer or Hioki representative.

Supplied accessories

Instruction manual
Soft case

Safety Notes



This device is designed to comply with IEC 61010-1 Safety Standards, and has been thoroughly tested for safety prior to shipment. However, mishandling during use could result in injury or death, as well as damage to the device. Be certain that you understand the instructions and precautions in the manual before use. We disclaim any responsibility for accidents or injuries not resulting directly from device defects.

1


Safety Symbols

This manual contains information and warnings essential for safe operation of the device and for maintaining it in safe operating condition. Before using the device, be sure to carefully read the following safety notes.



- The
 \(\bar{\Lambda} \) symbol printed on the device indicates that the user should refer to a corresponding topic in the manual (marked with the \(\bar{\Lambda} \) symbol) before using the relevant function.
- In the manual, the <u>\(\Lambda\)</u> symbol indicates particularly important information that the user should read before using the device.

The following symbols in this manual indicate the relative importance of cautions and warnings.

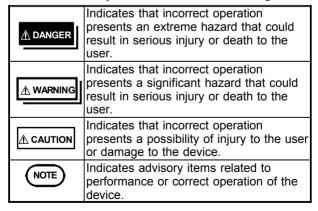


Overvoltage Categories (CAT)

This device conforms to the safety requirements for CAT I measurement instruments

To ensure safe operation of measurement instruments, IEC 60664 establishes safety standards for various electrical environments, categorized as CAT I to CAT IV, and called overvoltage categories. These are defined as follows.

- CAT I : Secondary electrical circuits connected to an AC electrical outlet through a transformer or similar instrument
- CAT II : Primary electrical circuits in equipment connected to an AC electrical outlet by a power cord (portable tools, household appliances, etc.)
- CAT III : Primary electrical circuits of heavy equipment (fixed installations) connected directly to the distribution panel, and feeders from the distribution panel to outlets.
- CAT IV: The circuit from the service drop to the service entrance, and to the power meter and primary overcurrent protection instrument (distribution panel).

 Higher-numbered categories correspond to electrical environments with greater momentary energy, so a measurement instrument designed for CAT III environments can endure greater momentary energy than one designed for CAT II. Using a measurement instrument in an environment designated with a higher-numbered category than that for which the instrument is rated could result in a severe accident, and must be carefully avoided.





Note on Use

Follow these precautions to ensure safe operation and to obtain the full benefits of the various functions

⚠ DANGER

To avoid short circuits and potentially lifethreatening hazards, follow these precautions.

- Never attach the 3273 to a circuit that operates at more than 300V, or over bare conductors.
- While the core section is open, and when conductors being measured carry in excess of the safe voltage level (SELV-E) and not more than 300 V, make sure that conductors to be measured are insulated with material conforming to (1) Overvoltage Category I, (2) Basic Insulation Requirements for Working Voltages of 300 V, and (3) Pollution Degree 2. For safeties sake, never use this sensor on bare conductors. The core and shield case are not insulated.
- Be careful to avoid damaging the insulation surface while taking measurements.

<u></u> **∆** DANGER

- This device is made for use with the 3272
 POWER SUPPLY. It is possible to use a power
 supply other than the 3272, provided that the
 connector and pin assignments match, and that
 voltage and other electrical specifications are
 satisfied. In the interest of safety, make sure
 that the power supply has a protective earthing
 with double-insulation construction.
- Make sure that the waveform measuring equipment connected to this device's output terminal (BNC) is equipped with a protective earthing with double-insulation construction.
- To avoid electric shock, do not touch the portion beyond the barrier during use.
- If the waveform measuring instrument being connected to the output terminal (BNC) on this device is equipped with any other measurement terminals, take the following precautions to ensure that the other instrument does not form a bridge between the probe and any hazardous live of a part.
 - Isolate the terminal to which the probe is connected from other terminals on the measuring instrument using basic insulation conforming to the overvoltage category, working voltage, and pollution degree requirements of the circuit being tested.

<u></u> **∆** DANGER


- If <u>basic insulation</u> requirements cannot be met between the terminal to which this device is connected and other terminals of the measuring instrument, make sure that the voltage input to the measurement terminal does not exceed the <u>safe voltage level (SELV-E)</u>.
- Read and observe all warnings and precautions relating to electrical safety for the measuring instrument being connected to the probe.

Refer to the following standards regarding the meanings of underlined terms.

IEC61010-1 IEC61010-2-031 IEC61010-2-032

⚠ DANGER

- Be sure to observe all operating precautions for the waveform monitoring instrument (oscilloscope or recorder) and other measurement instruments to which this device is connected
- When using a measurement instrument that does not provide isolation between its input terminals and chassis or other input terminals, please pay attention to the following points. If a signal is applied to an input terminal other than that to which this device is connected, do not connect the ground-side terminal to any non-ground potential. Otherwise, short-circuit current will flow through the 3272 or this device from the ground terminal, which could cause an electrical accident or damage.

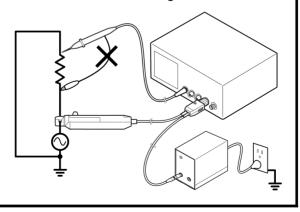

⚠ WARNING

 Do not allow the device to get wet, and do not take measurements with wet hands. This may cause an electric shock.

⚠ CAUTION

- To avoid damage to the device, protect it from vibration or shock during transport and handling, and be especially careful to avoid dropping.
- Do not store or use the device where it could be exposed to direct sunlight, high temperature or humidity, or condensation. Under such conditions, the device may be damaged and insulation may deteriorate so that it no longer meets specifications.
- Before using the device the first time, verify that it operates normally to ensure that the no damage occurred during storage or shipping. If you find any damage, contact your dealer or Hioki representative.
- This device is not designed to be entirely water- or dust-proof. To avoid damage, do not use it in a wet or dusty environment.
- The sensor head is a precision assembly including a molded component, a ferrite core, and a Hall effect element. It may be damaged if subjected to sudden changes in ambient temperature, or mechanical strain or shock, and therefore great care should be exercised in handling it.

⚠ CAUTION

- The matching surfaces of the sensor head are precision ground, and should be treated with care.
 If these surfaces are scratched, performance may be impaired.
- Measurements are degraded by dirt on the mating surfaces of the sensor head, so keep the surfaces clean by gently wiping with a soft cloth.
- To avoid damaging the sensor cable and power supply cable, do not bend or pull the cables.
- When the power is on, keep the core section of the sensor closed, except when clamping them onto the conductor to be measured. The facing surface of the core section can be scratched while it is open.



 Correct measurement may be impossible in the presence of strong magnetic fields, such as near transformers and high-current conductors, or in the presence of strong electromagnetic fields such as near radio transmitters.

Service / Maintenance

- To clean the device, wipe it gently with a soft cloth moistened with water or mild detergent. Never use solvents such as benzene, alcohol, acetone, ether, ketones, thinners or gasoline, as they can deform and discolor the case.
- If damage is suspected, contact your dealer or Hioki representative.
- When sending the device for repair, pack carefully to prevent damage in transit. Include cushioning material so the 3273 cannot move within the package. Be sure to include details of the problem. Hioki cannot be responsible for damage that occurs during shipment.

Chapter 1 Overview


1.1 Product Overview

This device can be directly connected to a BNC input connector of a waveform measuring instrument such as an oscilloscope or recorder, and by clamping on a conductor to be measured, allows the current waveform to be easily captured.

1.2 Features

- · Highly accurate current detection
- · Easy current measurement
- Broadband frequency characteristics DC to 50 MHz
- Compact and permits measurement of low current levels
- Easy protect function at excessive input
- Unique HIOKI development of thin film Hall effect element

1.3 Names of Parts External view

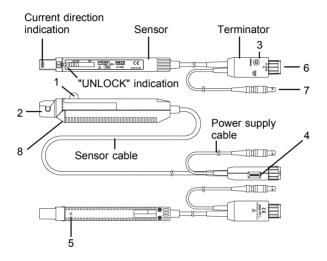

1.4 Parts of the Sensor

1. Opening lever

Operating lever for opening the sensor head. Always use this lever to open the sensor head.

2. Sensor head

This clamps the conductor being measured, and carries out the actual current measurement. It is a precision assembly including a molded component, a ferrite core, and a Hall effect element. It may be damaged if subjected to sudden changes in ambient temperature, or mechanical strain or shock, and therefore great care should be exercised in handling it.

3. Demagnetizing switch (DEMAG)

This demagnetizes the core if it has been magnetized by switching the power on and off, or by an excessive input. Always carry out demagnetizing before measurement.

The demagnetizing process takes about one second. During demagnetizing, a demagnetizing waveform is output.

4. Zero adjustment dial (ZERO ADJ)

Use the zero adjustment dial to correct for the effect of a voltage offset or temperature drift on the device. When beginning measurement, after demagnetizing always carry out zero adjustment.

5. Coarse adjustment trimmer

Use this only when adjustment is not possible within the range of the zero adjustment dial. Use a nonconductive screwdriver (e.g., ceramic driver) for adjustment.

6. Output connector

The current waveform of the measured conductor is output at a constant rate (0.1 V/A). Connect to the BNC input connector of the waveform measuring instrument.



- The output of this device is terminated internally. Use a high-impedance input to the measuring instrument. With an input impedance of 50Ω , accurate measurement is not possible.
- If using BNC-banana plug adapters or similar to connect to input terminals other than BNC connectors, make sure the polarity is correct.
- Turn the collar until it clicks, and check that it is locked securely.

7. Power plug Connect this to the 3272 POWER SUPPLY receptacle to supply power to the sensor terminator.

8. Barrier

This structure reduces the likelihood of touching the conductor while testing, and indicates the limit of safe physical contact. Avoid touching the clamp in front of the barrier when clamping or measuring.

Chapter 2 Specifications

2.1	Product	Speci	fications
4	1 IOGUCE	OPCUI	HUULIUHS

Guaranteed at 23°C \pm 5°C (73°F \pm 9°F) after the power has been on for 30 minutes.

Frequency range	DC to 50 MHz (-3 dB) (Characteristics shown in Fig. 1)
Rise time	7 ns or less
Maximum continuous input range	15 A Derating according to frequency shown in Fig. 2
Maximum peak current value	Non-continuous 30 A peak; at pulse width \leq 10 μ s, 50 A peak
Output voltage rate	0.1 V/A
Amplitude accuracy	±0.5% rdg. ±1 mV (DC, and 45 to 66 Hz, input within continuous maximum input range)
Noise	Equivalent to 2.5 mA rms or less (for 20 MHz band measuring instrument)
Input impedance	(Characteristics shown in Fig.3)
Temperature coefficient for sensitivity	$\pm 2\%$ or less (within a range of 0 to 40 °C, within a range of 32 to 104 °F)

Maximum rated power	3 VA
Rated supply voltage	±12 V ±1 V
Operating temperature and humidity range	0 to 40°C (32 to 104°F), 80 %RH or less (no condensation)
Storage temperature and humidity range	-10 to 50 $^{\circ}$ C (14 to 122 $^{\circ}$ F), 80 %RH or less (no condensation)
Location for use	Indoor, altitude up to 2000 m (6562 feet)
Period of guaranteed accuracy	1 year (Opening/Closing up to 10,000 times)
Effect of external magnetic fields	Equivalent to a maximum of 20 mA (in a 60 Hz,400 A/m AC current magnetic field)
Maximum rated voltage to earth	300 V, CAT I (insulated conductor)
Diameter of measurable conductors	5 mm dia. 0.2" dia.
Cable lengths	Sensor cable Approx. 1.5 m (59.0") Power supply cable Approx. 1 m (39.4")
External dimensions	Sensor Approx. 175Wx18Hx40Dmm Approx. 6.89"Wx0.71"Hx1.58"D Terminator Approx. 27Hx55Wx18D mm Approx. 1.06"Wx2.17"Hx0.71"D

Mass	Approx. 230 g Approx. 8.1 oz.
Accessories	Instruction manual, soft case

2.2 Standards Applying

Safety	EN61010-2-032:1995 Overvoltage category I (anticipated transient overvoltage 1500 V), Pollution Degree 2
EMC	EN61326:1997+A1:1998+A2:2001

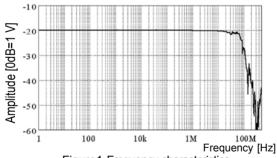


Figure 1 Frequency characteristics

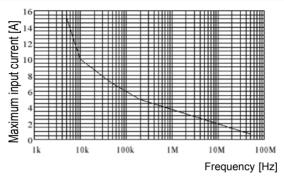


Figure 2 Derating according to frequency

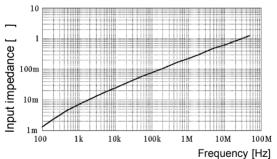


Figure 3 Input impedance (Characteristics)



Chapter 3 Measurement Procedure

3.1 Notes on Use



To avoid short circuits and potentially lifethreatening hazards, follow these precautions.

- Never attach the 3273 to a circuit that operates at more than 300V, or over bare conductors.
- While the core section is open, and when conductors being measured carry in excess of the safe voltage level (SELV-E) and not more than 300 V, make sure that conductors to be measured are insulated with material conforming to (1) Overvoltage Category I, (2) Basic Insulation Requirements for Working Voltages of 300 V, and (3) Pollution Degree 2. For safeties sake, never use this sensor on bare conductors. The core and shield case are not insulated.
- Be careful to avoid damaging the insulation surface while taking measurements.

<u></u> **M** DANGER

- This device is made for use with the 3272 POWER SUPPLY. It is possible to use a power supply other than the 3272, provided that the connector and pin assignments match, and that voltage and other electrical specifications are satisfied. In the interest of safety, make sure that the power supply has a protective earthing with double-insulation construction.
- Make sure that the waveform measuring equipment connected to this device's output terminal (BNC) is equipped with a protective earthing with double-insulation construction.
- To avoid electric shock, do not touch the portion beyond the barrier during use.
- If the waveform measuring instrument being connected to the output terminal (BNC) on this device is equipped with any other measurement terminals, take the following precautions to ensure that the other instrument does not form a bridge between the probe and any hazardous live of a part.
- 1. Isolate the terminal to which the probe is connected from other terminals on the measuring instrument using basic insulation conforming to the overvoltage category, working voltage, and pollution degree requirements of the circuit being tested.




- If <u>basic insulation</u> requirements cannot be met between the terminal to which this device is connected and other terminals of the measuring instrument, make sure that the voltage input to the measurement terminal does not exceed the <u>safe voltage level (SELV-E)</u>.
- Read and observe all warnings and precautions relating to electrical safety for the measuring instrument being connected to the probe.

Refer to the following standards regarding the meanings of underlined terms.

IEC61010-1 IEC61010-2-031 IEC61010-2-032

<u></u> **∆** DANGER

- Be sure to observe all operating precautions for the waveform monitoring instrument (oscilloscope or recorder) and other measurement instruments to which this device is connected
- When using a measurement instrument that does not provide isolation between its input terminals and chassis or other input terminals, please pay attention to the following points. If a signal is applied to an input terminal other than that to which this device is connected, do not connect the ground-side terminal to any non-ground potential. Otherwise, short-circuit current will flow through the 3272 or this device from the ground terminal, which could cause an electrical accident or damage.

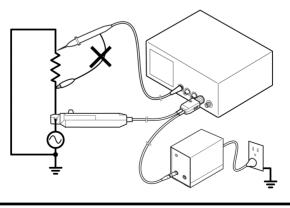


3.2 Preparations for Measurement

(1) Have the 3272 POWER SUPPLY, and oscilloscope or recorder for waveform measurement ready.

⚠ CAUTION

Before turning on the power, make sure that the voltage of the power supply being used matches the supply voltage indicated on the rear panel of the 3272.

- (2) Turn the power switch off and connect the power cord.
- (3) Connect the power plug of the 3273 to the power receptacle of the 3272.

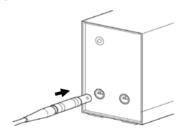


(4) Turn the 3272 power switch on, and check that the front panel power indicator lights.

3.3 Demagnetizing and Zero Adjustment




- The output of this device is terminated internally. Use a high-impedance input to the measuring instrument. With an input impedance of 50Ω , accurate measurement is not possible.
- (1) With the waveform measurement instrument input at ground, adjust the trace to the zero position.
- (2) Set the input coupling of the waveform measurement instrument to DC.
- (3) Connect the output connector of the 3273 to the input connector of the waveform measurement instrument. Turn the collar until it clicks, and check that it is locked securely.

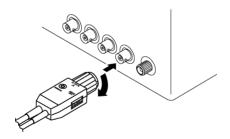

⚠ CAUTION

 - When disconnecting the output connector, be sure to release the lock, then pull the connector.
 Forcibly pulling the connector without releasing the lock, or pulling on the cable will result in damage to the terminator.
- If using BNC-banana plug adapters or similar to connect to input terminals other than BNC connectors, make sure the polarity is correct.
- Do not demagnetize while the 3273 is clamping a conductor to be measured. Demagnetizing causes current to flow into the conductor, which may damage parts in the circuit to be measured.




- Check that the conductor being measured is not clamped when supplying power to the 3273 for the same reason. Demagnetized waveforms are generated when supplying electric power.
 - (4) Without clamping the conductor to be measured, press the opening lever until the "UNLOCK" indication disappears, and check that the sensor head is properly closed.
 - (5) Press the demagnetizing switch (DEMAG) on the terminator.
 - (6) Turn the zero adjustment dial on the terminator, to adjust the trace to the zero position.


(7) If zero adjustment is not possible in step 6, turn the coarse adjustment trimmer to bring the trace within the range of adjustment by the zero adjustment dial.

3.4 Measurement Procedure

 - Check that the system is safe, and that the preparations described in the preceding section have been carried out.
- (2) Pull the sensor opening lever, so that the sensor head opens.



 
- (3) Align the sensor so that the current direction indication corresponds to the direction of current flow through the conductor to be measured, and clamp so that the conductor is in the center of the sensor aperture.
- (4) Press the opening lever on the sensor head until the "UNLOCK" indication disappears, and check that the opening lever is firmly locked and the sensor head securely closed.



(5) It is now possible to monitor the current waveform. The output rate of the 3273 is 0.1 V/A. The current sensitivity can be derived from the voltage sensitivity of the waveform measurement instrument. For example, if the voltage sensitivity is 10 mV/division, the current sensitivity is 100 mA/division



- When using the 3273, note that two clamp-on probes may not be used simultaneously with the 3272 POWER SUPPLY, depending on the current to be measured
- The current consumption of clamp-on probes depends on the current to be measured. Confirm that the total current consumption of the clamp-on probes does not exceed the rated output current of the 3272. See Figure 1.

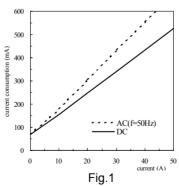


Current consumption* vs. current to be measured(typical)
*The sum total of a positive and negative current consumption



- The maximum continuous input range is based on heat that is internally generated during measurement. Never input current in excess of this level. Exceeding the rated level may result in damage to the probe.
- The maximum continuous input range varies according to the frequency of the current being measured. See the figures in 2.1, "Product Specifications"
- If excess current is input, generated heat activates a built-in safety function that blocks normal output. If this happens, remove the input immediately (remove the sensor from the conductor being measured, or reduce the input current to zero). Wait until the sensor has had sufficient time to cool before resuming operation.
- Even if the input current does not exceed the rated continuous maximum, continuous input for an extended period of time may result in activation of the safety circuit to prevent damage resulting from heating of the sensor.
- At high ambient temperatures, the built-in safety circuit may activate at current input levels below the rated continuous maximum.
- Continuous input of current exceeding the rated maximum or repeated safety circuit activation will degrade performance of the safety circuit, possibly resulting in damage to the device.



 - The probe is rated for maximum input under two conditions in addition to the input maximums shown in the "Product Specifications." These are (1) 30 Apeak, for non-continuous input, and (2) 50 Apeak for pulse widths $\leq 10 \mu s.$ (1) indicates an upper waveform response limit of 30 Apeak. Use the sensor at RMS current input levels that are within the rated continuous maximums. (2) indicates the upper response limit for a single input pulse.
- When opening the sensor head of the probe, be sure to operate with the opening lever. If an upper core is forced to open, when the sensor head is locked, the open-close mechanism can






- The output of this device is terminated internally. Use a waveform measurement instrument with an input impedance of at least 1 $M\Omega$.
- Immediately after powering on, this device may be subject to an appreciable offset drift due to the effect of self-heating. To counteract this, allow the device to warm up for about 30 minutes before carrying out measurement.



- When performing continuous measurements, it is necessary to be aware that the offset voltage drifts, depending on factors such as the ambient temperature.
- Under certain circumstances, oscillation may occur
 if the probe is connected to the 3272 POWER
 SUPPLY while the power supply is on. This does
 not indicate a malfunction. Oscillation can be
 stopped and operation restored to normal by
 opening and closing the sensor head.
- Depending on the measured current frequency, however some sound may be produced by resonance, it has no effect on measurements.
- The reading may be affected by the position within the clamp aperture of the conductor being measured. The conductor should be in the center of the clamp aperture.
- When carrying out measurement, press the opening lever until the "UNLOCK" indication disappears, and check that the sensor head is properly closed. If the sensor head is not properly closed, accurate measurement will not be possible.
- At high frequencies, common mode noise may affect measurements taken on the high voltage side of circuits. If this occurs, reduce the frequency range of the waveform measuring instrument, or clamp onto the low-voltage side of the circuit, as appropriate.

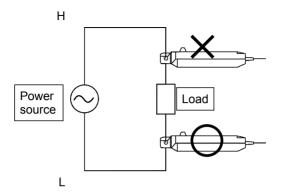



 Accurate measurement may be impossible in locations subject to strong external magnetic fields, such as transformers and high-current conductors, or in locations subject to strong external electric fields, such as radio transmission equipment.

HIOKI

DECLARATION OF CONFORMITY

Manufacturer's Name: HIOKI E.E. CORPORATION

Manufacturer's Address: 81 Koizumi, Ueda, Nagano 386-1192, Japan

Product Name: CLAMP ON PROBE

Model Number: 3273

The above mentioned product conforms to the following product specifications:

pecification

Safety: EN61010-2-032:1995

EMC: EN61326:1997+A1:1998 +A2:2001

ClassB equipment

Minimum immunity test requirement

Supplementary Information:

The product herewith complies with the requirements of the Low Voltage Directive 73/23/EEC and the EMC Directive 89/336/EEC.

HIOKI E.E. CORPORATION

in Histori

7 November 2003

Yuji Hioki

President

3273A999-02