この取扱説明書には本器を安全に操作し、安全な状態に保つのに要する情報や 注意事項が記載されています。本器を使用する前に下記の安全に関する事項 をよくお読みください。

取扱説明書の注意事項には、重要度に応じて以下の表記がされています。

⚠警告	操作や取扱いを誤ると、使用者が死亡または重傷につながる可 能性があることを意味します。
⚠注意	操作や取扱いを誤ると、使用者が傷害を負う場合、または機器を損傷する可能性があることを意味します。
注記	製品性能および操作上でのアドバイス的なことを意味します。

#### 安全記号

本器がお手元に届きましたら、輸送中において異常または破損がないか点検し てからご使用ください。特に付属品および、パネル面のスイッチ、端子類に注 意してください。万一、破損あるいは仕様どおり動作しない場合は、お買上店 (代理店)か最寄りの営業所にご連絡ください。

#### ご使用にあたっての注意

#### 

電圧のかかっている箇所の温度測定はしないでください。短絡事故や感 電事故になります。

本器の損傷を避けるため、AC アダプタの極性がセンタマイナスであるこ とを確認してから接続してください。

#### - 🛕 注 意 -

測定は金属部先端で行ない、柄およびコードを測定温度中にさらさない よう注意してください。

直射日光や高温、多湿、結露するような環境下での、保存や使用はしない でください。変形、絶縁劣化を起こし、仕様を満足しなくなります。 本器の損傷を避けるため、出力端子を短絡したり電圧を入力したりしな いでください。

温度プローブのシースの中には酸化マグネシウムの粉末が充填されてい ます。万が一、プローブが破損した場合、酸化マグネシウムの粉末が流出 する可能性がありますので、シースに過度な力が加わらないように取り 扱いにご注意ください。酸化マグネシウム粉末を大量に摂取すると健康 を損なう恐れがあります。

### 各部の名称



#### 仕様

測定節用 : -50 ~ 999 分解能

温度センサ : 熱電対 K ( CA )

入力抵抗 :2 M 以上 基準接点補償 : ダイオードにより自動補償

オーバレンジ表示 : OVER バーンアウト(センサ断線)表示 : OVER

: "BATT' 電池消耗表示

確度(23±3 において):±0.2%f.s.±1 dgt.

(センサ精度を除く) 校正は JIS C1602 熱起電力表による。

基準接点補償およびリニアライザの誤差を

含む。

確度保証期間 :1年 温度係数 : 0.1 dgt/ サンプル時間 :約0.8 s/回

使用温湿度範囲 : 0 ~ 50 80% rh 以下

保存温度範囲 : -10 ~ 50

雷源 : 積層形乾電池(6F22) × 1

(DC9 V×1)(連続使用:約25時間) 寸法・質量 : 約 75W×173H×24D mm 約 220 g 付属品 : 取扱説明書、積層形乾電池(6F22)

ソフトケース

オプション : 9094 出力コード、9036 AC アダプタ

## センサ(オプション)

#### 9180/9183 シース形温度プローブ

素線・接点の種類 : K ( CA ) 非接地形

許容差 (JIS C1602) : クラス 1 (旧階級 0.4 級)・・・・・・ 9183

クラス2(旧階級 0.75級)・・・・・・ 9180

金属シース寸法 :約 3.2×150 mm

補償導線 :一般用(-20~90 )約1m 測定温度範囲 :-50~750 (握り部耐熱150)

: SUS316 金属シース材質

: AC500 V (50/60 Hz) 1 分間 耐雷圧

絶縁抵抗 : 100 M 以上(DC100 V)

#### 9181 表面形温度プローブ

素線・接点の種類 : K ( CA ) 接地形 測定確度 : ±2.5 [(T-Ts) 100 ]

> $-0.035 \times T \sim +2.5 [100 < (T-Ts)]$ T:測定温度(-50~400)

Ts:周囲温度(0~50) 外形寸法 :約 15×110 mm

補償導線 :一般用(-20~90)約1m 測定温度範囲 :-50~400 (握り部耐熱 150)

## 9182 シース形温度プローブ

素線・接点の種類 :K(CA) 非接地形 許容差 (JIS C1602) : クラス2(旧階級0.75級) 金属シース寸法 :約 3.2×500 mm 補償道線 :耐熱用(0~150 )約2m

:-50~750 (フランジ部耐熱90) 測定温度範囲


金属シース材質 : INCONFI

: AC500 V (50/60 Hz) 1 分間 耐雷圧 絶縁抵抗 : 100 M 以上(DC100 V)

## 熱電対の許容差について

温度プローブに使用している熱電対はJIS C1602-1995 に規定されているクラ ス1、またはクラス2相当のものを使用しています。許容差については以下の 値を参考としてください。


クラス 1:-40 以上で±1.5 、または測定温度の±0.4%のどちらか大きい値 クラス2:-40 以上で±2.5 、または測定温度の±0.75%のどちらか大きい値 9180/9183 シース形温度プローブ

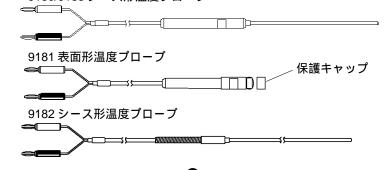

#### 測定方法

(1) 乾電池 (6F22) を収納します。

使用中、表示部に"BATT"マークが点灯しましたら、電池が消耗しています ので新しいものと交換してください。

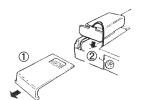

- ① 電池カバーを OPEN の方向へスライド させて外します。
- ② 電池を電池スナップにはめて収納カバ -をします。このとき、電池スナップ をカバーにはさまないよう注意してく ださい
- (2) センサを接続します。

バナナプラグの赤側(クロメル側)を"+"に、黒側(アルメル側)を"-"に差 し込みます。

- (3) 電源ホールドスイッチを"ON"の位置にして測定を行なってください。
- (4) 測定した値をホールドしたい場合は、電源ホールドスイッチを **HOLD** の位 置にしますと、そのときの値がホールドされます。
- (5) 使用が終わりましたら、電源ホールドスイッチを"OFF"の位置にしてくだ さい

#### アナログ出力

出力は1 あたり1 mV(0 のとき0V)出力されますので、測定する温度に 応じて、記録計のレンジを決めてください。


アナログ出力 : 1 mV/ 出力抵抗 :10 以下 確度 : ± 0.25%f.s. 温度係数 : 1 mV/10

注記 ・センサが断線(バーンアウト)したり接続されていなかったりします と1 V 以上の電圧が出力されますので、低レンジで測定しているとき は注意してください。

・入力(センサ入力端子)とアナログ出力は絶縁されていませんので注 意してください。

## 測定上の注意

- (1) 被測定物の内部温度を測定する場合、保護管の直径の15~20倍の長さを挿 入してください(シース形の場合)
- (2) 被測定物と検出端とを十分に接触させてください(表面形の場合)。 表面形温度プローブでは、温度測定部を接触させることによる放熱などの 影響で真の表面温度に対して誤差が大きくなることがあります。 (3) 周囲温度が急激に変化する場所での使用は、基準接点補償が不平衡状態に
- なりますので、本体とセンサを接続して20~30分測定場所に置いて基準接 点補償を平衡状態にして使用してください。
- (4) 温度プローブの柄の部分は高温にならないように測定してください。

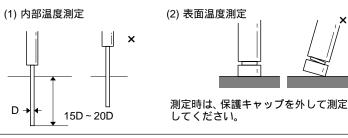

## 電池交換

#### - 🛝 警 告

感電事故を避けるため、プローブを被測定物より外してから、ケースを開 け、電池を交換してください。交換後は、必ずカバーをしてから、使用し てください。

使用済の電池をショート、分解または火中への投入はしないでください。 破裂する恐れがあり危険です。

使用済の電池は地域で定められた規則に従って処分してください。

- 🔞

# HIOKI

## 3412-50 **TEMPERATURE HITESTER** 温度ハイテスタ

## INSTRUCTION MANUAL

#### はじめに

このたびは、HIOKI "3412-50 温度ハイテスタ" をご選定いただき、誠にありがとうございます。 この製品を十分にご活用いただき、末長くご使 用いただくためにも、取扱説明書はていねいに 扱い、いつもお手元に置いてご使用ください。

日本語 ページ ① English Page 6


August 2003 Revised edition 2

## 保守・サービス

サービス

- ・故障と思われるときは、電池の消耗、プローブの断線を確認してから、お 買上店(代理店)か最寄りの営業所にご連絡ください。
- 輸送中に破損しないように梱包し、故障内容も書き添えてください。輸送 中の破損については保証しかねます。 本器のクリーニング

本器の汚れをとるときは、柔らかい布に水か中性洗剤を少量含ませて、軽く ふいてください。ベンジン、アルコール、アセトン、エーテル、ケトン、シ ンナー、ガソリン系を含む洗剤は絶対に使用しないでください。変形、変色 することがあります。

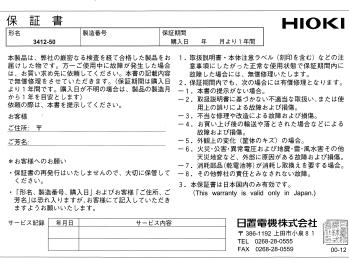

## HIOKI 日置電機株式会社

UHL http://www.niok.co.jp/ 東 北 (営) TEL022-288-1931 FAX022-288-1934 名古屋(営) TEL052-702-6807 FAX052-702-694: 〒984-0011 組合市政科区大丁の目認可 8・ 富重センタービル 3・ 〒485-0081 名古屋市名東区高間町 22

東京(営)TEL03-5835-2851 FAX03-5835-2852 広島(営)TEL082-879-2251 FAX082-879-2253 下101-0032 千代田区岩本町2-3-3 友泉岩本町ピル1F 〒731-0122 広島市安佐両区中筋3-28-13 中部時間ピル9F 特 販 課 TEL03-5835-2855 FAX03-5835-2856 福 岡 (営) TEL092-482-3271 FAX092-482-3275 〒101-0032 千代田区岩本町2-3-3 友泉岩本町ビル1F 〒812-0006 福岡市博多区上牟田3-8-19 みなみビル1F

長野(営) TEL0268-28-0561 FAX0268-28-0569 大阪(営) TEL06-6871-0088 FAX06-6871-0025 〒386-1192 上田市小泉 81 〒560-0085 豊中市上新田 2-13-7

A LAB

JAB ab Accreditation account to when

北関東(営) TEL048-266-8161 FAX048-269-3842 〒333-0847 川口市芝中田 2-23-24 日電ビル

神奈川(営) TEL046-224-8211 FAX046-224-8992 〒243-0016 厚木市田村町 8-8 柳田ビル 5F

■修理・校正業務のご用命は弊社まで・・・ISO / IEC 17025 認定取得日置エンジニアリングサービス株式会社

〒386-1192 上田市小泉 81 TEL0268-28-0823 FAX0268-28-0824

3412A981-02 03-08H Printed in Japan

#### Introduction

Thank you for purchasing the HIOKI "3412-50 TEMPERATURE HITESTER". To obtain maximum performance from the product, please read this manual first, and keep it handy for future reference.

## Safety

This manual contains information and warnings essential for safe operation of the product and for maintaining it in safe operating condition. Before using the product, be sure to carefully read the following safety notes.

The following symbols in this manual indicate the relative importance of cautions and warnings.

	<b>⚠</b> WARNING	Indicates that incorrect operation presents a significant hazard that could result in serious injury or death to the user.
	<b>⚠</b> CAUTION	Indicates that incorrect operation presents a possibility of injury to the user or damage to the product.
	NOTE	Advisory items related to performance or correct operation of the product.

#### Safety symbols



In the manual, the  $\triangle$  symbol indicates particularly important information that the user should read before using the product.

#### Inspection

When you receive the product, inspect it carefully to ensure that no damage occurred during shipping. In particular, check the accessories, panel switches, and connectors. If damage is evident, or if it fails to operate according to the specifications, contact your dealer or Hioki representative.

#### **Precautions**

#### - 🗥 WARNING -

Do not attempt to measure the temperature of objects carrying a voltage. Doing so will result in a short-circuit accident or an electrocution accident.

In order to prevent damage to the product, make sure that the center terminal on the AC adapter is negative before using the AC adapter.

## **⚠** CAUTION

When measuring temperature, use only the metal tip portion of the probe. Do not expose or immerse the handle or cable portion of the probe.


Do not store or use the product where it could be exposed to direct sunlight, high temperature or humidity, or condensation. Under such conditions, the product may be damaged and insulation may deteriorate so that it no longer meets specifications.

To avoid damage to the product, do not short the output terminal and do not input voltage to the output terminal. In order to prevent damage to the unit, make sure that the center terminal on the AC adapter is negative before using the AC adapter.

The sheath of the temperature probe is filled with magnesium oxide powder. If the probe is broken, the magnesium oxide powder may spill out. Be careful not to subject the sheath to excess stress. Inhaling large quantities of magnesium oxide may be hazardous to your health.


- **(3**) -

#### **Part Names**

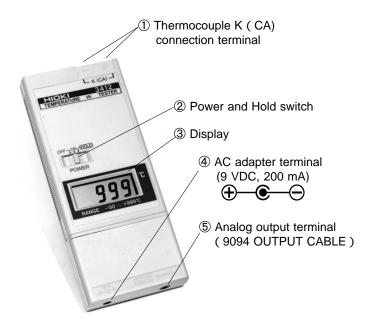

#### **Measurement Procedure**

(1) Install the 6F22 battery During the unit use, low battery voltage is indicated by "BATT" appearing in the display. Replace the battery at this time.

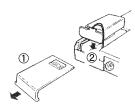

- ① To remove the battery cover, slide it in the direction of the arrow marked OPEN.
- ② Snap the battery connector on the battery, put the battery into the battery compartment, then reattach the battery cover. Make sure the battery snap cord is not pinched by the battery cover.
- (2) Connect the sensor. Plug the red banana plug into the (+) terminal, and the black plug into (-) terminal.
- (3) Place the power/hold switch in the **"ON"** position and take the measurement.
- (4) If you desire to hold the reading, position the power/hold switch to HOLD. The value in the display at this time will be held.
- (5) When you are through using the meter, position the power/hold switch to "**OFF**".

### Analog output

Output from 3412-50 is 1 mV per 1  $\,$  (0 V at 0  $\,$  ). Set recorder range according to the temperature you are going to measure.

NOTE • If the probe circuit is broken wire (rearing), or not connected securely, voltage output will exceed 1 V. Be careful when using the recorder in the lower ranges.

- 🔞 -

 Note that input (sensor input terminal) and analog output is not insulated.

## **Specifications**

Measurement Range: -50 to 999, -58 to 1830°FMeasurement Resolution: 1Measurement Sensor: Thermocouple, K type

Input Resistance : Approx. 2 M or more
Reference Junction Compensation : Automatic, by diode

Over range Display : "OVER"
Burnout Display : "OVER"
Low Battery Display : "BATT"

Accuracy :  $\pm 0.2\%$ f.s.  $\pm 1$  dgt. (at 23  $\pm 3$  ) Accuracy includes errors in reference junction

compensation and in linearizer.

Guaranteed accuracy period : 1 year Temperature Coefficient : 0.1 dgt/

Sampling Time : Approx. 0.8 s/sample

Operating Temperature/Humidity : 0 to 50 (32 to 122°F) < 80% RH

Storage Temperature : -10 to 50 ,14 to 122°F Power source : One (6F22 ) battery (9 VDC x 1)

( Life : Approx.25 hours )

AC adapter : 9 VDC-200 mV, has 5 mm dia terminal

Dimensions : Approx.75W x 173H x 24D mm, Approx.2.95W" x 6.8H" x 0.94D"

: Approx. 220 g, 7.8 oz

Accessories : Instruction Manual, 6F22 battery, Soft case

Option : 9094 OUTPUT CABLE

#### **Sensor Probe (optional)**

Mass

#### 9180/9183 SHEATH TYPE TEMPERATURE PROBE

Thermocouple Material : K type

 $\pm 1.5 \ (\pm 2.7^{\circ}F) \text{ or } \pm 0.4\% \text{rdg.},$ 

whichever is greater.

Dimensions (Sheath) : Approx.  $3.2 \times 150$  mm,  $0.13" \times 5.91"$ 

Compensation Lead : Conventional type (-20 to 90 ), Approx. 1 m, 39.4"

Operating Temperature : -50 to 750 , -58 to 1382°F

Allowable Heat (Handle) : 150 , 302°F

Protective Shield Material : SUS 316

Dielectric Strength : 500 VAC ( 50/60 Hz ) for 1 minute Isolation Resistance : 100 M or more ( 100 VDC )

#### 9181 SURFACE TEMPERATURE PROBE

Thermocouple Material : K type Contact Type : Grounded

Measurement Accuracy :  $\pm 2.5 (\pm 4.5^{\circ}F)[(T-Ts) \ 100 \ (180^{\circ}F)]$ -0.035 × T to +2.5 (4.5°F)

[100 (180 F) < (T-Ts)]
T: Measurement temperature
(-50 to 400 , -58 to 752°F)
Ts: Surroundings temperature
(0 to 50 , 32 to 122°F)

Dimensions : Approx.  $15 \times 110 \text{ mm}$ ,  $0.59 \times 4.33 \times 100 \text{ compensation Lead}$  : Conventional type (-20 to 90 , -4 to 194°F),

Approx. 1 m , 39.4"

Operating Temperature : -50 to 400 , -58 to 752°F

Allowable Heat (Handle) : 150 , 302°F

## 9182 SHEATH TYPE TEMPERATURE PROBE

Thermocouple Material : K type

Contact Type : Isolated junction (ungrounded)
Accuracy :  $\pm 2.5$  ( $\pm 4.5^{\circ}$ F) or  $\pm 0.75^{\circ}$ rdg.

whichever is greater.

Dimensions (Sheath) : Approx.  $3.2 \times 500$  mm,  $0.13" \times 19.7"$  Compensation Lead : Heat resisting type (0 to 150 ,32 to 302°F).

Approx. 2 m, 78.8"

Operating Temperature : -50 to 750 , -58 to 1382°F Allowable Heat (Flange) : 90 , 194°F

Protective Shield Material : INCONEL

 $\begin{array}{ll} \textbf{Dielectric Strength} & : 500 \text{ VAC (} 50/60 \text{ Hz )} \text{for 1 minute} \\ \textbf{Isolation Resistance} & : 100 \text{ M} & \text{or more (} 100 \text{ VDC )} \\ \end{array}$ 

## 9180/9183 SHEATH TYPE TEMPERATURE PROBE




9182 SHEATH TYPE TEMPERATURE PROBE

## \_

#### **Measurement Precautions**

- (1) Where the inner temperature of a fluid is to measured, immerse the probe to a depth of 15 to 20 times the diameter of the protective shield. (Applicable to sheath type probe.)
- (2) For surface temperature measurements, make sure that solid thermal contact is made with the object being measured. The surface type temperature probe is designed to maximize the heat capacity of the measuring point. However, errors may occur due to effects such heat dissipation on contact.
- (3) If the unit is used in a place where sudden changes in ambient temperature are expected, unbalanced reference contact compensation will result. It will be necessary, therefore, to connect the sensor to the main unit and leave them at the measurement place for 20 to 30 minutes in order to balance the reference contact compensation prior to
- (4) Do not overheat the handle portion of temperature probes.

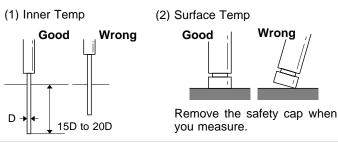

## **Battery replacement**

#### - ⚠ WARNING

To avoid electric shock when replacing the batteries, first disconnect the probe from the object to be measured. Before using the product after replacing the batteries, replace the cover.

To avoid the possibility of explosion, do not short circuit, disassemble or incinerate batteries.

Handle and dispose of batteries in accordance with local regulations.

## Maintenance/Service

## Service

- If the product seems to be malfunctioning, confirm that the batteries are not discharged, and that the probes are not open circuited before contacting your dealer or Hioki representative.
- Pack the product carefully so that it will not be damaged during shipment, and include a detailed written description of the problem. Hioki cannot be responsible for damage that occurs during shipment.

## Cleaning

To clean the product, wipe it gently with a soft cloth moistened with water or mild detergent. Never use solvents such as benzene, alcohol, acetone, ether, ketones, thinners or gasoline, as they can deform and discolor the case.



### **HEAD OFFICE**

81 Koizumi, Ueda, Nagano 386-1192, Japan TEL +81-268-28-0562 / FAX +81-268-28-0568 E-mail: os-com@hioki.co.jp URL http://www.hioki.co.jp

## HIOKI USA CORPORATION

6 Corporate Drive, Cranbury, NJ 08512, USA TEL +1-609-409-9109 / FAX +1-609-409-9108